



NISSAN NORTH AMERICA, INC.
Copyright ©

SB 631333 86

SERVICE BULLETIN

Classification:

BT02-015

Reference:

NTB02-041

Date

April 9, 2002

2002 ALTIMA; WIND NOISE DUE TO HOLE IN DOOR SEALER

Qced

APPLIED VEHICLE: 2002 Altima

MAY 22 2002

SERVICE INFORMATION

If a 2002 Altima exhibits wind noise (buzzing or whistling sound) around the left or right front door area, particularly in cross-wind conditions, there may be a hole in the door panel sealer at the front edge of the door.

Use the service procedure in this bulletin to diagnose and resolve the incident, if it should occur.

SERVICE PROCEDURE

Fill the area shown in figure 1 with 3M Acryl-Green Spot Putty #05960 sealer. Use appropriate touch-up paint to cover the sealer.

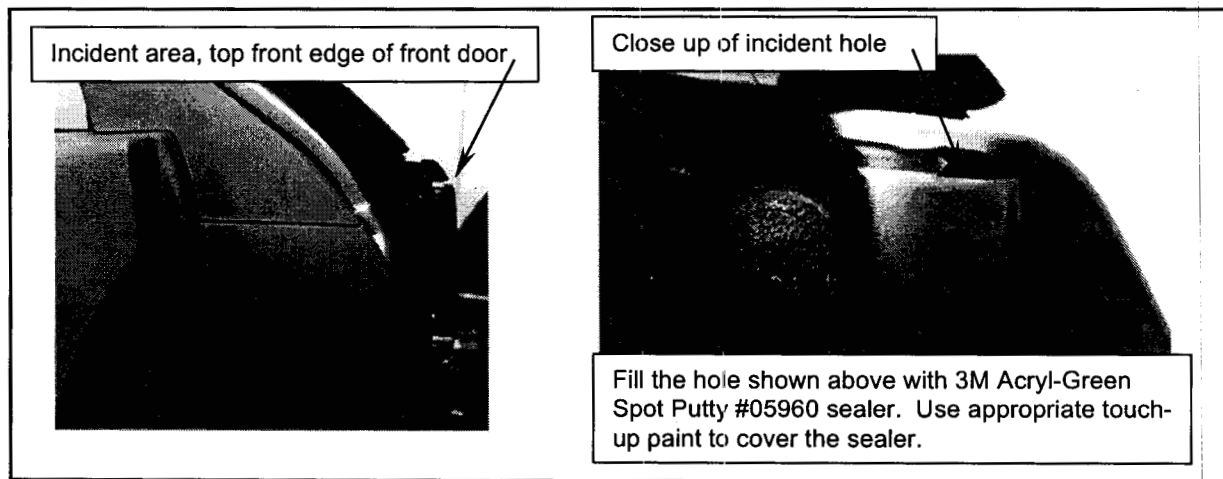


Figure 1

631333

CLAIMS INFORMATION

Submit a Primary Operation (PO) line claim using the following claims coding:

NOTE: Please do NOT claim the spot putty – it is considered normal shop supply.

DESCRIPTION	OP CODE	SYM	DIA	FRT
Reseal around front door glass - R/H	UYC999	ZU	53	(1)

1. Straight-time operation – use the actual hours.

AND/OR

DESCRIPTION	OP CODE	SYM	DIA	FRT
Reseal around front door glass - L/H	UYD999	ZU	53	(1)

1. Straight-time operation – use the actual hours.
